



RELEASE NOTES

Version 6.1.1 | July 2014 | 3725-76310-001B

Polycom[®] RealPresence[®] Distributed Media Application[™] (DMA) 7000 System



Copyright ©2014, Polycom, Inc. All rights reserved. No part of this document may be reproduced, translated into another language or format, or transmitted in any form or by any means, electronic or mechanical, for any purpose, without the express written permission of Polycom, Inc.

6001 America Center Drive
San Jose, CA 95002
USA



Polycom®, the Polycom logo and the names and marks associated with Polycom products are trademarks and/or service marks of Polycom, Inc. and are registered and/or common law marks in the United States and various other countries. All other trademarks are property of their respective owners. No portion hereof may be reproduced or transmitted in any form or by any means, for any purpose other than the recipient's personal use, without the express written permission of Polycom.



Java is a registered trademark of Oracle America, Inc., and/or its affiliates.

End User License Agreement By installing, copying, or otherwise using this product, you acknowledge that you have read, understand and agree to be bound by the terms and conditions of the End User License Agreement for this product.

Patent Information The accompanying product may be protected by one or more U.S. and foreign patents and/or pending patent applications held by Polycom, Inc.

Open Source Software Used in this Product This product may contain open source software. You may receive the open source software from Polycom up to three (3) years after the distribution date of the applicable product or software at a charge not greater than the cost to Polycom of shipping or distributing the software to you. To receive software information, as well as the open source software code used in this product, contact Polycom by email at OpenSourceVideo@polycom.com.

Disclaimer While Polycom uses reasonable efforts to include accurate and up-to-date information in this document, Polycom makes no warranties or representations as to its accuracy. Polycom assumes no liability or responsibility for any typographical or other errors or omissions in the content of this document.

Limitation of Liability Polycom and/or its respective suppliers make no representations about the suitability of the information contained in this document for any purpose. Information is provided "as is" without warranty of any kind and is subject to change without notice. The entire risk arising out of its use remains with the recipient. In no event shall Polycom and/or its respective suppliers be liable for any direct, consequential, incidental, special, punitive or other damages whatsoever (including without limitation, damages for loss of business profits, business interruption, or loss of business information), even if Polycom has been advised of the possibility of such damages.

Customer Feedback We are striving to improve our documentation quality and we appreciate your feedback. Email your opinions and comments to DocumentationFeedback@polycom.com.



Visit the [Polycom Support Center](#) for End User License Agreements, software downloads, product documents, product licenses, troubleshooting tips, service requests, and more.

What's New in the Version 6.1.1 Release

The Polycom RealPresence DMA system version 6.1.1 is primarily a maintenance release that resolves the customer issues listed in Resolved Issues on page 21. In addition, this release includes:

Site Name Length Restricted in Embedded DNS Configurations

In embedded DNS configurations, the length of site names is now restricted to 52 characters. If you upgrade a system to 6.1.1 with embedded DNS enabled, the DNS service will not resolve any sites whose names are longer than 52 characters. You need to change the site names to match this limit. Upgrading your system to 6.1.1 will not automatically change the site names on your system to conform to the new length restriction.

API Changes and Additions

This version of the RealPresence DMA system brings the following improvements to the API:

plcm-user

- The `plcm-user-v3` and `plcm-user-list-v3` resources have been added.
 - The `plcm-user-v3` resource adds the new fields “chairperson-passcode” and “conference-passcode”.
 - The `plcm-user-list-v3` resource returns a list of `plcm-user-v3` resources.

End of Support for Dell PowerEdge 1950 Server

The Dell PowerEdge 1950 server is no longer supported as of the version 6.1 release. The Dell server used for new RealPresence DMA system, Appliance Edition installations is the PowerEdge R620 server. For more information about migrating to the R620 server or to the RealPresence DMA system, Virtual Edition, please contact your Polycom sales representative.

Please note:

- Versions of the RealPresence DMA system software prior to 5.2 have not been tested and so are not supported on the R620 server.
- A monitor and keyboard are required to run the Dell server diagnostic utilities on the R620 server.
- The Dell server diagnostic utilities are to be used only under the direction of Polycom Global Services.

About the RealPresence DMA 7000 System

The Polycom RealPresence DMA 7000 system is a highly reliable and scalable video collaboration infrastructure solution. The following information describes its two key components: the Conference Manager function and the Call Server function.

Use of this software constitutes acceptance of the terms and conditions of the Polycom RealPresence DMA 7000 system end-user license agreement (EULA). The EULA for your version is available on the Polycom Support page for the Polycom RealPresence DMA 7000 system.

Conference Manager

- Provides a highly reliable and scalable multipoint conferencing solution that distributes voice and video calls across multiple media servers (MCUs), creating a single seamless resource pool. The system essentially behaves like a single large MCU, which greatly simplifies video conferencing resource management, improves efficiency, and facilitates ad hoc (reservationless) conferencing.
- Supports up to 64 MCUs and 1200 concurrent conference (virtual meeting room, or VMR) calls.
- MCUs can be added on the fly without impacting end users and without requiring re-provisioning.

Call Server

- Provides complete endpoint registration and call routing services for both H.323 and SIP protocols.
- Also serves as a gateway between H.323 and SIP, enabling enterprises with legacy H.323 devices to begin transitioning to the use of SIP in a gradual, orderly, and cost-effective manner.
- Provides bandwidth management, including tracking resource usage and controlling excessive resource usage.
- Can be integrated with a Juniper Networks Session and Resource Control Module (SRC) that provides bandwidth assurance services.
- Comes with a default dial plan that covers many common scenarios, but which can be modified in a simple, but powerful and flexible, way.

The Call Server makes it possible for multiple UC environments and different video conferencing technologies to be unified across the network into a single dial plan.

Clustering and Superclustering

The Polycom RealPresence DMA system, Appliance Edition can be configured as a cluster of two co-located servers, providing a highly reliable system with no single point of failure. The RealPresence DMA system, Virtual Edition can be deployed as a supercluster of up to five geographically dispersed, but centrally managed, single-node systems to provide greater reliability, geographic redundancy, and better network traffic management. The RealPresence DMA system, Appliance Edition can be deployed as a supercluster of up to five geographically dispersed, but centrally managed, RealPresence DMA system

clusters (two-server or single-server). Up to three of the systems in a supercluster can have Conference Manager enabled.



Note: Local cluster unsupported in RealPresence DMA Virtual Edition

Configurations of the Polycom RealPresence DMA system, Virtual Edition are similar to the Appliance Edition, but have some important differences.

Superclustering of individual RealPresence DMA system, Virtual Edition instances is fully supported in a virtual environment. The RealPresence DMA system, Virtual Edition does not support the same two-server local cluster configuration as the Appliance Edition. However, VMware® vSphere HA may be used to protect against server-level failures.

Polycom recommends use of RealPresence DMA system superclusters to protect against failure of individual RealPresence DMA system Virtual Edition instances, and vSphere HA for hardware resiliency. See your VMware documentation for more information on vSphere HA.

The systems in a supercluster share a common data store. Each system maintains a local copy of the data store, and changes are replicated to all the systems.

A five-system supercluster supports up to 25,000 concurrent calls and 75,000 registrations.

Other Key Features

The Polycom RealPresence DMA 7000 system also:

- Integrates with Microsoft® Active Directory®, automating the task of provisioning users for video conferencing. Combined with its advanced resource management, this makes ad hoc video conferencing on a large scale feasible and efficient, reducing or eliminating the need for conference scheduling.
- Integrates with Microsoft Exchange Server, enabling users who install the Polycom Conferencing Add-in for Microsoft Outlook to set up Polycom Conferencing meetings in Outlook.
- Integrates with Microsoft Lync® environments, allowing Lync clients and non-Lync endpoints registered to the RealPresence DMA system to join the same conference transparently.
- Integrates with a Polycom RealPresence® Resource Manager or CMA system to obtain site topology and user-to-device association data.
- Includes the RealPresence Platform Application Programming Interface (API), which provides programmatic access to the Polycom RealPresence DMA system for the following:
 - Provisioning
 - Conference control and monitoring
 - Call control and dial-out
 - Billing and usage data retrieval
 - Resource availability queries

The API uses XML encoding over HTTPS transport and adheres to a Representational State Transfer (REST) architecture.

The RealPresence Platform API is licensed separately for use by third-party client applications.



Note: API Licenses

A Polycom RealPresence Resource Manager system can access the API without needing an API license. An API license is only needed if a client application developed by you or a third party is going to access the API.

- SNMP support

An SNMP agent provides access to MIBs for the RealPresence DMA application, CentOS operating system, Java Virtual Machine, and server hardware, enabling your network management system to monitor the Polycom RealPresence DMA system and receive notifications (traps and informs).

The system supports SNMPv3 communications with authentication and privacy.

System Capabilities and Constraints

The following capabilities and constraints apply to the entire supercluster:

- Number of sites: 500
- Number of subnets: 5000
- Number of clusters in a supercluster: 5 (not counting an integrated Polycom RealPresence Resource Manager or CMA system)
- Number of MCUs enabled for conference rooms: 64
- Number of territories enabled for conference rooms (Conference Manager enabled): 3
- Number of concurrent VMR calls: 1200 per cluster (Conference Manager), up to 3600 total
- Number of concurrent SIP<->H.323 gateway calls: 500
- Size of Active Directory supported: 1,000,000 users and 1,000,000 groups (up to 10,000 groups may be imported)
- The following capabilities and constraints apply to each cluster in the supercluster:
 - Number of registrations: 15000
 - Number of concurrent H.323 calls: 5000
 - Number of concurrent SIP calls: 5000
 - Total number of concurrent calls: 5000
 - Number of network usage data points retained: 8,000,000
 - Number of IRQ messages sent per second: 100
 - Maximum number of history records retained per cluster:
 - 500,000 registration history
 - 2,000,000 registration signaling
 - 500,000 call history
 - 200,000 conference history

Support for the RealPresence DMA System, Virtual Edition

In addition to the standard Appliance Edition, this version of the RealPresence DMA system is available in an edition packaged for VM-based deployment.

Deploying with RealPresence Platform Director

Virtual editions of Polycom RealPresence Platform products such as RealPresence DMA require the RealPresence Platform Director system to deploy the software and manage licensing. The RealPresence Platform Director provides the flexibility to deploy, license and monitor the RealPresence Platform, Virtual Edition products using general purpose hardware in an organization's data center or in the cloud.

The RealPresence Platform Director is available at no charge on Polycom's support website at <http://support.polycom.com>.

Features Not Supported with the Virtual Edition

Keep in mind the following differences between the Appliance and Virtual Editions of the RealPresence DMA system:

- The Polycom RealPresence DMA system, Virtual Edition does not support two-server redundant configuration as with the Appliance Edition. Polycom recommends using vSphere HA to protect against host-level failures. See your VMware documentation for more information.
- Maximum Security Mode is not supported by the RealPresence DMA system, Virtual Edition.

Software Version History

Only versions released for General Availability are listed.

Software Version History

<i>Release</i>	<i>API Version</i>	<i>System</i>	<i>Release Date</i>	<i>Features</i>
6.1.1	2.5.3	CentOS 6.5 Java 8u5 PostgreSQL 9.3	July 2014	Maintenance release to fix specific issues.

<i>Release</i>	<i>API Version</i>	<i>System</i>	<i>Release Date</i>	<i>Features</i>
6.0.6	1.7.7	CentOS 6.4 Java 7u21 PostgreSQL 9.2.4	July 2014	Maintenance release to fix specific issues.
6.1	2.5.2	CentOS 6.5 Java 8u5 PostgreSQL 9.3	June 2014	Lync 2013 support, enhanced upgrade framework, centralized licensing support, Management Instrumentation, enhanced H.323 and SIP statistics, enhanced High Availability functionality, H.323 firewall rate limit, enhanced conference template features, enhanced API functionality, cascade support for SVC and mixed-mode conferences.
6.0.5	1.7.6	CentOS 6.4 Java 7u21 PostgreSQL 9.2.4	May 2014	Maintenance release to fix specific issues.
6.0.4	1.7.5	CentOS 6.4 Java 7u21 PostgreSQL 9.2.4	February 2014	Maintenance release to fix specific issues, MPMRx and RealPresence Collaboration Server 1800 MCU support.
5.2.2.6	1.2.2	CentOS 5.8 Java 7u9 PostgreSQL 9.2.1	January 2014	Maintenance release to fix specific issues.
6.0.3	1.7.4	CentOS 6.4 Java 7u21 PostgreSQL 9.2.4	December 2013	Maintenance release to fix specific issues, conference template enhancements surrounding high resolution content.
5.2.2.5	1.2.2	CentOS 5.8 Java 7u9 PostgreSQL 9.2.1	December 2013	Maintenance release to fix specific issues.
5.2.2.4	1.2.2	CentOS 5.8 Java 7u9 PostgreSQL 9.2.1	October 2013	Maintenance release to fix specific issues.
6.0.2.1	1.7.2	CentOS 6.4 Java 7u9 PostgreSQL 9.2.2	August 2013	Maintenance release to fix specific issues.

<i>Release</i>	<i>API Version</i>	<i>System</i>	<i>Release Date</i>	<i>Features</i>
5.2.2.3	1.2.2	CentOS 5.8 Java 7u9 PostgreSQL 9.2.1	August 2013	Maintenance release to fix specific issues.
6.0.2	1.7.1	CentOS 6.4 Java 7u9 PostgreSQL 9.2.2	July 2013	RealPresence DMA-controlled VEQs with operator support, enhanced call/conference history and CDRs, resource priority (AS-SIP) support, ANAT support, gatekeeper blacklist, management connection whitelist, simplified history retention settings, single-server shutdown, new conference template setting.
5.2.2.2	1.2.2	CentOS 5.8 Java 7u9 PostgreSQL 9.2.1	July 2013	Maintenance release to fix specific issues.
5.2.2	1.2.2	CentOS 5.8 Java 7u9 PostgreSQL 9.2.1	June 2013	Maintenance release to fix specific issues.
5.2.1	1.2.1	CentOS 5.8 Java 7u9 PostgreSQL 9.2.1	March 2013	Maintenance release to fix specific issues.
5.2.0	1.2.1	CentOS 5.8 Java 7u9 PostgreSQL 9.2.1	December 2012	Cascading for size, mixed AVC/SVC conferences, FW NAT keep-alive, improved subscription events reporting, new MCU support, enhanced API control of MCUs, removal of XMPP server. Database changed from MySQL to PostgreSQL 9.2.1.
5.0.2	1.0.1	CentOS 5.8 Java 6u20	December 2012	Maintenance release to fix specific issues.
5.1.0_P1	1.1.0	CentOS 5.8 Java 7u9	December 2012	Maintenance release to fix specific issues.
5.1.0	1.1.0	CentOS 5.8 Java 7u9	November 2012	SVC conferencing, RFC 4575 support, untrusted traffic identification and handling, network setting changes, upgrade process monitoring, configuration-only backups.

The Consequences of Enabling Maximum Security Mode

Enabling the **Maximum security** setting is *irreversible* and has the following significant consequences:

- All unencrypted protocols and unsecured access methods are disabled.
- The boot order is changed and USB ports are disabled so that the server(s) can't be booted from the optical drive or a USB device.
- A BIOS password is set.
- The port 443 redirect is removed, and the system can only be accessed by the full URL (<https://<IP>:8443/dma7000>, where <IP> is one of the system's management IP addresses or a host name that resolves to one of those IP addresses).
- For all server-to-server connections, the system requires the remote party to present a valid X.509 certificate. Either the Common Name (CN) or Subject Alternate Name (SAN) field of that certificate must contain the address or host name specified for the server in the Polycom RealPresence DMA system.

Polycom RealPresence Collaboration Server and RMX MCUs don't include their management IP address in the SAN field of the CSR (Certificate Signing Request), so their certificates identify them only by the CN. Therefore, in the Polycom RealPresence DMA system, a Polycom MCU's management interface must be identified by the name specified in the CN field (usually the FQDN), not by the IP address.

Similarly, an Active Directory server certificate often specifies only the FQDN. So in the Polycom RealPresence DMA system, identify the enterprise directory by FQDN, not by the IP address.

- Superclustering is not supported.
- The Polycom RealPresence DMA system can't be integrated with Microsoft Exchange Server and doesn't support virtual meeting rooms (VMRs) created by the Polycom Conferencing Add-in for Microsoft Outlook.
- Integration with a Polycom RealPresence Resource Manager or CMA system is not supported.
- On the **Banner** page, **Enable login banner** is selected and can't be disabled.
- On the **Login Sessions** page, the **Terminate Session** action is not available.
- On the Troubleshooting Utilities menu, Top is removed.
- In the **Add User** and **Edit User** dialog boxes, conference and chairperson passcodes are obscured.
- After **Maximum security** is enabled, management interface users must change their passwords.
- If the system is not integrated with Active Directory, each local user can have only one assigned role (Administrator, Provisioner, or Auditor).

If some local users have multiple roles when you enable the **Maximum security** setting, they retain only the highest-ranking role (Administrator > Auditor > Provisioner).

- If the system is integrated with Active Directory, only one local user can have the Administrator role, and no local users can have the Provisioner or Auditor role.

If there are multiple local administrators when you enable the **Maximum security** setting, the system prompts you to choose one local user to retain the Administrator role. All other local users, if any, become conferencing users only and can't log into the management interface.

Each enterprise user can have only one assigned role (Administrator, Provisioner, or Auditor). If some enterprise users have multiple roles (or inherit multiple roles from their group memberships), they retain only the lowest-ranking role (Administrator > Auditor > Provisioner).

- Local user passwords have stricter limits and constraints (each is set to the noted default if below that level when you enable the **Maximum security** setting):
 - Minimum length is 15-30 characters (default is 15).
 - Must contain 1 or 2 (default is 2) of each character type: uppercase alpha, lowercase alpha, numeric, and non-alphanumeric (special).
 - Maximum number of consecutive repeated characters is 1-4 (default is 2).
 - Number of previous passwords that a user may not re-use is 8-16 (default is 10).
 - Minimum number of characters that must be changed from the previous password is 1-4 (default is 4).
 - Password may not contain the user name or its reverse.
 - Maximum password age is 30-180 days (default is 60).
 - Minimum password age is 1-30 days (default is 1).
- Other configuration settings have stricter limits and constraints (each is set to the noted default if below that level when you enable the **Maximum security** setting).

Session configuration limits:

- Sessions per system is 4-80 (default is 40).
- Sessions per user is 1-10 (default is 5).
- Session timeout is 5-60 minutes (default is 10).

Local account configuration limits:

- Local user account is locked after 2-10 failed logins (default is 3) due to invalid password within 1-24 hours (default is 1).
 - Locked account remains locked either until unlocked by an administrator (the default) or for a duration of 1-480 minutes.
- Software build information is not displayed anywhere in the interface.
 - You can't restore a backup made before the **Maximum security** setting was enabled.
 - If you're using the Mozilla Firefox browser, you need to configure it to support TLS version 1.1 so that it can function correctly with a RealPresence DMA system configured for Maximum Security Mode.

File uploads may fail when using the Mozilla Firefox browser unless the proper steps have been taken. See the *Polycom RealPresence DMA 7000 System Deployment Guide for Maximum Security Environments*, the *Polycom RealPresence DMA 7000 System Operations Guide*, or the online help.

System and Network Requirements

- For best reliability, deploy the Polycom RealPresence DMA 7000 system into a good-quality IP network with low latency and very little packet loss.
 - In systems with Active Directory integration, the network between the RealPresence DMA system and Active Directory should have less than 200 ms round-trip latency and less than 4% round-trip packet loss.
 - The network between clusters of a Polycom RealPresence DMA supercluster should have less than 200 ms round-trip latency and less than 2% round-trip packet loss.
 - The network between the Polycom RealPresence DMA system and all MCUs should have less than 200 ms round-trip latency and less than 2% round-trip packet loss. Since this network carries only signaling traffic (the RTP stream goes directly from the endpoint to the MCU), bandwidth is not an issue.
 - The network between the Polycom RealPresence DMA system and video endpoints should have less than 200 ms round-trip latency and less than 6% round-trip packet loss.
- Computers used to access the management interface should have 1280x1024 minimum display resolution (wide screen, 1680x1050 or greater, recommended).
- Browser minimum requirements: Microsoft Internet Explorer® 7.0, Mozilla Firefox® 3.0, or Google Chrome 11 (with Adobe Flash plugin, not built-in Flash support).



Note: Latest version of Adobe Flash Player recommended

The Polycom RealPresence DMA system's management interface requires Adobe Flash Player. For stability and security reasons, we recommend always using the latest version of Flash Player.

Host Server Hardware Profiles

The following table describes the minimum and recommended server hardware profiles for each instance of the RealPresence DMA system, Virtual Edition. It also shows the typical performance capacities.

Recommended Hardware Profiles

<i>Component</i>	<i>Minimum Profile (Lab System)</i>	<i>Recommended Profile (Production System)</i>
CPU	1-physical-core Westmere, 2.4 GHz or more CPU clock	8-physical-core Westmere, 2.4 GHz or greater CPU clock (e.g., 8x Intel Xeon E5620 @ 2.4GHz)
Memory	4GB	12GB
Disk	64GB	146GB

<i>Component</i>	<i>Minimum Profile (Lab System)</i>	<i>Recommended Profile (Production System)</i>
Performance	5 concurrent calls, 15 registrations	1200 calls, 12000 registrations

Because of differences in hardware and VM environments, the performance information is provided for guidance purposes and does not represent a guarantee of any kind by Polycom.

Installation and Upgrade Notes

Installation of new Polycom RealPresence DMA 7000 systems is managed through Polycom Global Services. For more information, please contact your Polycom sales or support representative. Use the following guidelines to upgrade an existing system.

Existing System Upgrades

The following are points to keep in mind when you upgrade an existing RealPresence DMA system:

- The upgrade package for this software version allows any version 5.2.x or 6.x RealPresence DMA system to be upgraded to version 6.1.1.
- Call history, conference history, and CDR data are not preserved during upgrades from version 5.2.x or 6.0.x to version 6.1.x.
- Beginning with version 6.1, upon first login, the system now presents the End User License Agreement (EULA) acceptance dialog. After reading the EULA, select **I accept the terms of this license agreement** and click **Accept** to proceed to the dashboard.

The EULA acceptance dialog also provides a check box to enable or disable the automatic collection of usage data. For more information, refer to the *Polycom RealPresence DMA 7000 System Operations Guide*.

- See “Add Required DNS Records for the Polycom RealPresence DMA System” in the *Polycom RealPresence DMA 7000 System Operations Guide* and online help to ensure that you have the correct DNS entries for a successful deployment.



Caution: Allow plenty of time for upgrades and restores to complete

Give yourself plenty of time for the system upgrade process and restores from backup. When you upgrade the system or restore from backup, both of these processes will take some time, depending on the environment. For systems with large configuration data, especially a large number of Active Directory users, system upgrades and restores can take two hours or more.

MAKE SURE YOU WAIT UNTIL THE PROCESS IS COMPLETE. Rebooting the system or interrupting the upgrade can cause corruption.

During the most of the upgrade process, the RealPresence DMA system is offline and all services are unavailable. Do not power off the system unless instructed to do so.

Upgrade Paths

The following table outlines the paths you can take to upgrade to version 6.1.1, depending on what version your system is currently running:

Upgrade Paths to Version 6.1

Current Version	Intermediate Upgrade	Final Upgrade	New License Required
Prior to version 5.2.0	→ 5.2.0	→ 6.1.1	Yes
5.2.0 - 5.2.2.x		→ 6.1.1	Yes
6.0.x		→ 6.1.1	Yes
6.1		→ 6.1.1	No

Upgrade to version 6.1.1 of the RealPresence DMA System, Appliance Edition

You can upgrade a RealPresence DMA, Appliance Edition system to version 6.1.1 from the **Maintenance > Software Upgrade** page of the system's web interface.

Follow the instructions on the **Software Upgrade** page in the system's online help to upload and install the upgrade package (.bin file). For information on licensing the newly installed system, refer to the *Polycom RealPresence DMA System Getting Started Guide*.

Upgrade to version 6.1.1 of the RealPresence DMA System, Virtual Edition

The RealPresence DMA system, Virtual Edition now requires the RealPresence Platform Director system for deploying, licensing and monitoring instances of the system. Before upgrading your product software, be sure that you have already installed the RealPresence Platform Director system and verified that your product is licensed. See the *Polycom RealPresence Platform Director System Administrator's Guide*.

The RealPresence Platform Director system requires VMware vCenter Server.



Note: An unlicensed system cannot route calls

The previous licensing model allowed an unlicensed RealPresence DMA system, Virtual Edition to route up to 10 concurrent calls. As of version 6.1, the new Virtual Edition licensing model does not allow the system to route any calls or use the API unless a license has been configured from within RealPresence Platform Director.

To upgrade from a version 5.2.x of the RealPresence DMA system, Virtual Edition to version 6.1.1:

- 1 Create a backup of the system at its current state.
- 2 Follow the instructions in the *Polycom RealPresence DMA 7000 System Operations Guide* or the online help to upgrade the system to version 6.1.1.

- 3 Follow the instructions in the *Polycom RealPresence Platform Director System Administrator's Guide* to add an instance of the RealPresence DMA system, Virtual Edition to the RealPresence Platform Director system.

If you already use the RealPresence Platform Director system to manage this RealPresence DMA system, Virtual Edition instance, delete the previous instance before adding the new version 6.1.1 instance.

- 4 Verify that the upgraded RealPresence DMA system, Virtual Edition instance is available and operating correctly.

Interoperability

This section outlines things you may need to know when integrating the RealPresence DMA system with other devices.

Integration with Polycom MCUs

To support the Polycom RealPresence DMA system's High security setting, configure the Polycom RealPresence® Resource Manager and RMX MCUs being added to the system to accept encrypted (HTTPS) management connections.

The Polycom RealPresence DMA system uses conference templates to define the conferencing experience associated with a conference room or enterprise group. Conference templates can be free-standing or linked to a Polycom MCU conference profile. If you link templates to conference profiles, make sure the profiles exist and are defined the same on all the Polycom MCUs that the Polycom RealPresence DMA system uses.

Refer to the *Polycom RealPresence DMA 7000 System Operations Guide* or online help for more information on setting up MCUs for the Polycom RealPresence DMA system. Refer to the *Administrator's Guide* for your MCU for more information on enabling encrypted connections and creating conference profiles.

Important Notes Regarding Integration with Polycom MCUs

- To efficiently manage multiple calls as quickly as possible, the Polycom RealPresence DMA system uses multiple connections per MCU. By default, a Polycom MCU allows up to 20 connections per user (the MAX_NUMBER_OF_MANAGEMENT_SESSIONS_PER_USER system flag). We recommend not reducing this setting. If you have a RealPresence DMA supercluster with three Conference Manager systems and a busy conferencing environment, we recommend increasing this value to 30.
- The Automatic Password Generation feature, introduced in version 7.0.2 of the Polycom MCU software, is not compatible with the Polycom RealPresence DMA system. On Polycom MCUs to be used with the Polycom RealPresence DMA system, disable this feature by setting the system flags NUMERIC_CONF_PASS_DEFAULT_LEN and NUMERIC_CHAIR_PASS_DEFAULT_LEN both to 0 (zero).

- If the conference template selected for a conference specifies mixed AVC and SVC mode, the RealPresence DMA system doesn't limit the choice of MCU to those that support mixed mode:
 - If the MCU selected doesn't support SVC at all, the RealPresence DMA system starts the conference as an AVC-only conference. Otherwise, it starts a mixed mode conference.
 - If the MCU supports SVC-only conferences, but not the mixed AVC and SVC mode specified in the template, the conference simply doesn't start.
 - Use appropriately configured MCU pools and pool orders to limit mixed mode conferences to MCUs that support mixed AVC and SVC mode.

Products Tested with This Release

Polycom RealPresence DMA systems are tested extensively with a wide range of products. The following list is not a complete inventory of compatible systems. It simply indicates the products that have been tested for compatibility with this release.



Note: Latest software versions recommended

Polycom recommends that you upgrade all of your Polycom systems with the latest software versions. Any compatibility issues may already have been addressed by software updates. Go to http://support.polycom.com/PolycomService/support/us/support/service_policies.html to see the current Interoperability Matrix.

Products Tested with this Release

<i>Product</i>	<i>Tested Versions</i>
RealPresence Platform Virtual Edition Infrastructure	
Polycom RealPresence Platform Director (required for Virtual Edition)	1.7
Management Systems and Recorders	
Broadsoft BroadWorks	AS version Rel_20.sp1_1.606
Crestron Controller	4.001.1012
Crestron Polycom Build	3.1.2-2
IBM Sametime Server	Sametime 9
MS Exchange 2010	14.03.174.001 SP3 (UR4)
MS Exchange 2013	15.00.0775.038 (CU3)
Polycom CMA	6.2.5
Polycom CSS	1.3.0
Polycom MLA	3.1.2.8

<i>Product</i>	<i>Tested Versions</i>
Polycom Real Presence Capture Server	1.6.1
Polycom Real Presence Capture Server (VE)	1.6.1
Polycom RealPresence Resource Manager	8.0, 8.1, 8.2
Polycom RealPresence Resource Manager, Virtual Edition	8.2
Polycom RSS4000	8.5.1
Polycom RSS4000, Virtual Edition	8.6
Polycom TelePresence Tool	3.1.2
Gatekeepers, Gateways, SIP Servers and MCU's	
ACME SBC	SCX6.4.0 Patch 4 Bld 203
Avaya Aura CM	R016x.03.0.124.0
Avaya Aura SM	6.3.0.8.5682
Check Point Safe@Office 1000N	8.1.46
Cisco 3241 Gateway	2.1(1.49)
Cisco 3745	12.4
Cisco ASA5505-UL-BUN-K9	8.4
Cisco ASR-1002F	3.7.2
Cisco CTMS	1.9.3
Cisco SBC	3.7.3
Cisco Telepresence Server (TPS)	4.0(1.57)
Cisco Unified Communications Manager (CUCM)	9.1(2)
Cisco VCS	X8.1.1
Codian 4505 MCU	4.4(3.57)
Fortinet Fortigate 100D	v5.0,build0252 (GA Patch 5)
Fortinet Fortigate 310B	v5.0,build0252 (GA Patch 5)
Juniper J2320	11.4

<i>Product</i>	<i>Tested Versions</i>
Juniper NetScreen-ISG1000	6.3.0r10.0
Lync 2010 Server	4.0.7577.225 (CU11)
Lync 2013 Server	5.0.8308.577 (CU4)
Polycom Real Presence Collaboration Server 800s	8.4
Polycom RealPresence Access Director	4.0.0
Polycom RealPresence Access Director, Virtual Edition	4.0.0
Polycom RealPresence Collaboration Server (RMX) 1800	8.4
Polycom RealPresence Collaboration Server, Virtual Edition	8.4
Polycom RMX 1500, 2000, 4000 (MPMRx)	8.4
Polycom RMX 1500, 2000, 4000 (MPMx)	8.4
Polycom RMX Gateway	8.4
Polycom TCSPi	3.2.1
Polycom VBP-ST	11.2.18
Radvision ECS Gatekeeper	7.7.0.0.27
Radvision Scopia P10 Gateway	5.7.2.0.25
Tandberg Gatekeeper	N6.3
Tandberg Gateway	G3.2
Endpoints	
Avaya 10XX	4.8.3(23)
Avaya 1X Communicator	6.1.9.04-SP9-132
Avaya ADVD	1_1_2_020002
Avaya Flare Desktop	1.1.3.14
Avaya Flare Mobile (iOS)	1.1.2
Avaya Voice Phone	S3.171b
Broadsoft BroadTouch Business Communicator for PC	20.0.1.1649

<i>Product</i>	<i>Tested Versions</i>
Cisco C20	7.1.1
Cisco CTS 1300	1.10.5.1(4)
Cisco CTS 3010	1.10.5.1(4)
Cisco CTS500-32	6.1.2.1(5)
Cisco CTS500-37	1.10.5.1(4)
Cisco E20	4.1.3
Cisco Jabber for Windows	9.7.0
Cisco Jabber iPad	9.3.4
Cisco Jabber Video for Telepresence (windows)	4.6.3
Cisco SX20	7.1.1
Cisco TC C90	7.1.1
Cisco TC EX90	7.1.1
Cisco TX 1310	6.1.2.1(5)
Cisco TX 500-32	6.1.2.1(5)
Cisco TX 9000	6.1.2.1(5)
Cisco TX1300	6.1.2.1(5)
Cisco TX9000	6.1.2.1(5)
Crestron MLA	3.1.2.8
Crestron OTX/TPX	3.1.4-1
Crestron RPX	3.1.4-1
Crestron TelePresence Tool	3.1.4.1
Polycom HDX	3.1.4
IBM Sametime Connect Client	Sametime 9
IBM Sametime Lotus Client	Sametime 9
IBM Sametime Web AV Client	Sametime 9

<i>Product</i>	<i>Tested Versions</i>
LifeSize Desktop client	2.0.2.191
LifeSize Express 220	4.12.0(30)
LifeSize ICON 600	1.3.2
LifeSize Passport	4.12.0(30)
LifeSize Room	4.7.22(3)
LifeSize SoftPhone	8.1.12
LifeSize Team 200	4.7.22(3)
LifeSize Team 220	4.12.0(30)
Lync 2010 Client	4.0.7577.4419
Lync 2013 Client	15.0.4569.1503
Polycom CMA Desktop	5.2.5
Polycom CX500/CX600	4.0.7577.4420
Polycom CX7000	1.2.0
Polycom Group Series	4.1.3
Polycom Group Series Touch Controller	OS4.1.3-73 / TP 4.1.3.01-190025
Polycom OTX	3.1.3.2
Polycom PVX	8.0.16
Polycom QDX6000	4.0.3
Polycom RealPresence Desktop (Mac)	3.2
Polycom RealPresence Desktop (PC)	3.2
Polycom RealPresence Mobile Android Phone	3.2
Polycom RealPresence Mobile Android Tablet	3.2
Polycom RealPresence Mobile IOS iPad	3.2
Polycom RealPresence Mobile IOS iPhone	3.2
Polycom RPX	3.1.3.2

<i>Product</i>	<i>Tested Versions</i>
Polycom Sound Point 601 SIP	3.1.7
Polycom SoundPoint 650 SIP	4.0.4
Polycom SoundStation IP4000 SIP	3.1.7
Polycom SoundStation IP7000	4.0.4
Polycom Telepresence M100	1.0.6
Polycom Touch Control Operating System	1.10.0-11
Polycom Touch Control Panel Software	1.10.0-48
Polycom VSX	9.0.6.2
Polycom VVX 1500/500/600	5.1.0
Radvision Scopia XT1000	2.5.416
Radvision Scopia XT5000	8.3.0.61
Radvision ScopiaXT 5000	V3_2_1_10
Siemens OpenScape Desktop Client	V7 R1.17.0
Siemens OpenScape Media Server	V7.00.01.ALL.07_PS0010.E11
Siemens OpenScape UC	V7.00.01.ALL.07_PS0010.E11
Siemens OpenScape Voice	V7.00.01.ALL.07_PS0010.E11
Siemens OpenStage	V3_R1_43_0
Sony PCS-1	3.42
Sony PCS-G50	2.72
Sony PCS-G90	2.22
Sony PCS-TL50	2.42
Sony PCS-XG100	1.20
Sony PCS-XG80	2.42
Tandberg 150 MXP	L6.1
Tandberg 1700 MXP	F9.3.1

<i>Product</i>	<i>Tested Versions</i>
Tandberg 6000 MXP	F9.3.1
Tandberg Edge95 MXP	F9.1.2, F9.3.1

Resolved Issues

The following table lists the issues resolved in version 6.1.1 release.

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>
DMA-13556	6.0.6	<p>When an API client issues a GET request without specifying a version in the Accept header, the version returned in the response can be arbitrary.</p> <p>Changes have been made to return the earliest version (v1) of an object if there's no Accept header in the GET request.</p> <p>This change affects the following classes in 6.1.1 (shared API 2.5.3)</p> <p>PlcmSite</p> <p>PlcmSiteList</p> <p>PlcmSiteLink</p> <p>PlcmSiteLinkList</p> <p>PlcmMcu</p> <p>PlcmMcuList</p>
DMA-13493	6.0.5	<p>After a failover scenario in a clustered environment, the newly active node did not clear the conference connections that were hosted on the previously active node.</p> <p>Note: Although this issue is resolved, there may be a delay (up to two minutes) as the conference connections are cleared after failover is complete. This is normal behavior.</p>
DMA-13477	6.0.5 HF1	When you used the web management interface to edit a Polycom Conferencing (calendared) conference room, the Passback data that was associated with the conference room via API was deleted.
DMA-13462	6.0.4 HF2	Gateway calls between a Polycom Group Series endpoint registered to the DMA system via H.323 and a Siemens Openstage endpoint registered via SIP would not connect.
DMA-13461	6.0.4	The ISDN/PSTN Dial-in check box was automatically enabled for DMA system VMR conferences even if it was disabled within the RealPresence Collaboration Server or RMX conference template.
DMA-13455	6.0.5	If you configured Embedded DNS on the DMA system, DNS updates failed when site names were too long. The system now limits the length of site names when Embedded DNS is enabled.
DMA-13445	6.0.4 HF1	On the Network > MCU > MCUs page, the DMA system indicated Supports SVC conferences unreliably for version 7.8 and lower RMX MCUs.
DMA-13438	6.0.4	If an endpoint registered through an SBC did not provide a call signalling address in its LWRRQ message, the registration would time out due to the DMA system incorrectly identifying the IP address of the endpoint.

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>
DMA-13416	6.0.5	When you edit an Active Directory integrated user on the User > Users page, the system does not save data you enter in the User pass-through to CDR field on the Add/Edit User dialog.
DMA-13409	6.0.4	The DMA system would send an INVITE to a participant for different call speeds depending on if the participant was added before or after the conference started.
DMA-13407	6.0.4	The DMA system would sometimes disconnect certain endpoints from a call after a random amount of time due to an erroneous SIP session timeout.
DMA-13389	6.0.4	After a failover in a cluster or supercluster environment, the Polycom RMX system remained in Major Alarm status with the message "The MCCF channel is not connected". A reboot of the DMA system was needed to clear the alarm.
DMA-13368	6.0.4	If the DMA system forwarded a SUBSCRIBE message to an external address but never received a response, the system leaked the memory for the subscription object.
DMA-13356	6.0.4 HF2	In a superclustered environment, API commands to modify a participant could sometimes fail due to inconsistent internal representation of the state of the conference.
DMA-13355	6.0.5	When a registered SIP endpoint called a registered H.323 endpoint and the H.323 endpoint ended the call, the DMA system did not reclaim the call proxy object.
DMA-13348	6.0.4 HF2	The system did not limit the number of rapid, consecutive CDR queries it accepted via API; in some cases, this caused the system to become unresponsive.
DMA-13343	6.0.4 HF2	Backup and restore operations consumed more memory than necessary, potentially causing performance issues during periods of heavy conference load.
DMA-13323	6.0.4	A complex network topology involving multiple media paths and bandwidth calculations caused the DMA system to record incorrect bandwidth for a call due to floating point math imprecision. This could cause the system to detect a bandwidth change where there was none, potentially resulting in unexpected bandwidth restrictions.
DMA-13305	5.2.2 P3	In a superclustered configuration, a SIP re-invite from an MCU caused the destination information for active calls to be overwritten with call origin information.
DMA-13293	6.0.4	In previous versions of DMA system software, conferences configured for Cascade for size functionality sometimes did not cascade properly because the ports reserved for cascading had been consumed by video participants. Although you could solve this issue by increasing the number of video ports reserved per conference, this could lead to inefficient use of ports if the MCU hosted many conferences. To address this, the Cascade-for-size reserved video ports: Overall field has been added to the External MCU tab of the Add/Edit MCU dialog. Using this field, you can specify how many video ports to reserve for Cascade for size functionality for this MCU (this is in addition to the existing Per-conference value). This allows you to specify a lower value for the Per-conference setting while ensuring that the DMA system can still cascade a conference using video ports from the Overall pool if the conference's Per-conference reserved video ports are consumed.
DMA-13289	6.0.4	The DMA system sometimes reported per-conference port usage incorrectly for some versions of the Polycom RMX system.
DMA-13283	6.0.4	If a DMA system was integrated with Active Directory, backslash characters in conference room IDs of the existing local conference rooms sometimes caused the DMA system to create erroneous conference room entries in Active Directory.
DMA-13275	6.0.4 HF4	The DMA system did not route calls to an MCU when the MCU had only audio ports available.

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>
DMA-13273	6.0.2 P1	In certain superclustered configurations, if a connected endpoint was disconnected from a call abruptly (such as in network outage) and was unable to send a DRQ to the DMA system, the system reported the call as an Active Call on a different DMA system within the supercluster when no calls were active on that system.
DMA-13270	6.0.4	When you used the RealPresence Resource Manager system to schedule a pooled conference that used a DMA system conference template configured for a Telepresence Layout mode of Room Switch , dial-out participants did not see the correct preset view.
DMA-13244	6.0.3 HF1	If a participant dialed a VMR using the dial string format <VEQ number>*<VMR number>*<VMR conference passcode>, they would not see all of the conference participants.
DMA-13226	6.0.4	The Prefer routed check box on the Add External Gatekeeper dialog only worked if the external gatekeeper was assigned a prefix and was operating in routed mode.
DMA-12093	6.0.2 P1 HF1	When all non-reserved video ports on an MCU were in use, the DMA system routed H.323 calls to that MCU as video calls, instead of routing the calls as audio-only.

Known Issues

The following table lists the known issues in this Polycom RealPresence DMA 7000 system release.

Known Issues

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-13573	6.0.6	<p>SIP registrations to the DMA system expire after system upgrade to v6.0.5. When a SIP endpoint is registered for expiration time + 30s, then inactive until the next registration (~expiration-45s). This presents as the SIP endpoint cycling between active and inactive in the GUI.</p> <p>New fields created during the upgrade are unpopulated for existing registered endpoints. The endpoint believes it is successfully registered and can make calls. However, if the flag "Allow calls to inactive endpoints" is checked, then while "inactive", the endpoint would not be able to receive calls.</p>	Deleting the SIP endpoint will resolve the problem as it when it re-registers it will correct the issue.
DMA-13442	6.1	You cannot specify a specific MCU pool order for MCUs that provide cascade functionality for Microsoft Lync environments.	

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-13432	6.1	<p>The RealPresence DMA system does not allow spaces before or after the entry in the Next hop address field in the Add External SIP Peer dialog on the Network > External SIP Peers page.</p> <p>The online help and Operations Guide do not include this information.</p>	Remove any spaces in the field before clicking OK .
DMA-13399	6.1	If the RealPresence DMA system cannot resolve the SIP peer destination network via DNS, the system sends a SIP REGISTER message with no contact header.	
DMA-13393	6.1	If the RealPresence DMA system dials out to an endpoint registered to a Lync server, the system is unable to connect. The Lync server does not support SIP offerless INVITE requests.	
DMA-13382	6.1	You can't create a conference room with a single-character Room ID .	
DMA-13376	6.1	The Lync 2013 client does not show presence status of a VMR contact in the contact list after the VMR is edited by a RealPresence DMA system user.	
DMA-13313	6.1	For conferences that include a Polycom MCU and are scheduled from a RealPresence Resource Manager system, the "minVideoResolution", "maxVideoResolution", "minContentResolution", and "maxContentResolution" CDR columns are '0' for the calls.	
DMA-13288	6.1	When a Polycom HDX system registered to a Lync server calls a Polycom VVX system registered to the RealPresence DMA system as an H.323 endpoint, hold / resume functionality is unavailable.	
DMA-13285	6.1	If you import an Enterprise Group that has a group scope of "Global" and a group type of "Security" from Active Directory, the system produces an alert because it can't resolve the group's membership references.	

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-13274	6.1	When a LifeSize Team 200 endpoint is registered to the RealPresence DMA system via encrypted SIP, other endpoints cannot connect to the LifeSize endpoint. The Team 200 endpoint does not support TLS client connections.	
DMA-13255	6.1	When you dial an endpoint registered to the RealPresence DMA system using an endpoint registered to the system's SIP peer, the call fails and the RealPresence DMA system does not capture call details in the logs.	
DMA-13241	6.1	Conferences started with the API end prematurely if the first dial-out to a participant fails.	
DMA-13175	6.1	The format for the CDR column "destEndpoint" is incorrect for point to point SIP calls.	
DMA-13174	6.1	If you upgrade a RealPresence DMA, Appliance Edition system hosted on a Dell PowerEdge 1950 server from pre-6.1 software to version 6.1, the upgrade appears successful, but the system is not upgraded. The version 6.1 software does not support the PowerEdge 1950 server for upgrades or new installations. See End of Support for Dell PowerEdge 1950 Server for more information.	
DMA-13173	6.1	The CDR column "userRole" contains the value "null" in some calls when it should be blank.	
DMA-13168	6.1	If you rejoin a system with a supercluster while Active Directory integration is enabled with a very large Active Directory database, the rejoin operation can fail.	Temporarily disable Active Directory integration before rejoining the supercluster. After rejoining, re-enable Active Directory integration.
DMA-13120	6.1	If an endpoint's registration becomes inactive, the system does not remove it from the Network > Endpoints page after the Inactive registration deletion period is reached.	Manually remove the inactive endpoint from the list.

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-13063	6.1	When you add a SIP dial-out participant to a conference via API, the system can't locate the participant's endpoint identifier.	
DMA-13027	6.1	<p>The following errors exist in the Polycom RealPresence DMA REST API Reference Documentation:</p> <ul style="list-style-type: none"> ● plcm-conference-notification <ul style="list-style-type: none"> ➤ The plcm-conference-list namespace is not used; the conference notification always reports on one conference at a time (not a list). ➤ The XSD Elements/XSD Complex Types is missing an entry for plcm-conference. ● plcm-participant-notification <ul style="list-style-type: none"> ➤ The plcm-participant-list namespace is not used; the participant notification always reports on one participant at a time (not a list). ➤ The XSD Elements/XSD Complex Types is missing an entry for plcm-participant. 	
DMA-12962	6.1	The Admin > Call Server > Prefix Service page allows you to define duplicate Simplified ISDN Gateway Dialing prefixes.	
DMA-12888	6.1	In certain dial-out situations, the dial-out connection is not counted for the connected endpoint in the Active Calls column on the Network > Endpoints page.	
DMA-12877	6.1	In a split network interfaces configuration, the system is unable to integrate with a Microsoft Exchange server that resides on the RealPresence DMA system's signaling network.	
DMA-12816	6.1	The Number of Calls column on the Network > Site Statistics and Network > Site Link Statistics doubles the actual number of calls.	

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-12794	6.1	If H.323 device authentication is enabled and an endpoint calls a VMR while registered to a third-party gatekeeper that is using the RealPresence DMA system as an external gatekeeper without proper authentication, although the call fails, the Property Changes tab of the Call Details dialog incorrectly reports that the “Call completed successfully”.	
DMA-12739	6.1	If you connect a Lync 2013 client to a RealPresence DMA system VMR and attempt to transfer the call using the Lync 2013 transfer function, the call is transferred but media is blocked if the hosting MCU is using ICE or encryption features.	
DMA-12722	6.1	When you register a Polycom endpoint to a RealPresence DMA system and make a point to point call to a Lync 2013 client, the call will have no video. This is a limitation of the Lync 2013 client.	If the endpoint is a Polycom HDX or RealPresence Group Series, install an RTV license (HDX) or Lync Interoperability License (RealPresence Group Series) and register the endpoint to the Lync 2013 server before making the call.
DMA-12637	6.1	You can't configure routing information until other networking information has been configured and applied.	
DMA-12611	6.1	If an H.323 endpoint registered to a supercluster calls a SIP endpoint registered to the supercluster's external SIP peer, the call succeeds but the Reports > Call History page shows the Destination for the call as “Unresolved”.	
DMA-12566	6.1	If you install version 6.1 software from DVD to a RealPresence DMA system and then use a USB stick to configure it for split network interfaces, the IP address is not properly assigned and the system does not fully start.	
DMA-12513	6.1	If you create a conference room via API, it isn't displayed on the Conference Rooms column of the User > Users page until it is edited in the Conference Rooms dialog box.	

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-12318	6.1	<p>If you attempt to create more than 500 sites on a RealPresence DMA system using the API, the system returns an HTTP 409 response, because the system has a 500 site limit.</p> <p>The API documentation doesn't include the above information.</p>	
DMA-12287	6.1	The CDR column "bitrate" shows '?' for H.323 calls to a VMR.	
DMA-12206	6.0.2	During long conferences (8 to 14 hours), the Lync 2013 AVMCU stops responding to the RealPresence DMA system, causing the call to drop.	
DMA-12111	6.1	If you restart the RealPresence DMA system during a call, the system's Call History page reports that the "Endpoint ended the call normally".	
DMA-12110	6.1	If the RealPresence DMA system is restarted during a conference, the end time for the conference is blank on the Call History and Conference History pages, and the conference is not recorded in the CDR data.	
DMA-12084	6.1	When the RealPresence DMA system is configured for a System IP type of IPv4 + IPv6 and a registered IPv4 SIP endpoint changes its registration to IPv6, the system continues to communicate with the endpoint using the IPv4 address.	
DMA-12054	6.1	API: The territory-name field of the plcm-conference-room resource is optional when creating a conference room even though the RealPresence DMA system requires a territory when routing calls to conference rooms. Calls will fail to conference rooms created with no territory field included in the request.	
DMA-12034	6.1	The Management IP address field of the Add MCU dialog does not accept a bracketed IPv6 address.	

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-12014	6.1	The variable REG_SITE_COUNTRY_CODE is not properly set within registration policy compliance scripts.	
DMA-12012	6.1	The variable REG_SITE_NAME is not properly set within registration policy compliance scripts.	
DMA-11934	6.1	The "OrigSignalingID" CDR column reports the incorrect signaling ID for the VMR leg of a SIP VEQ call.	
DMA-11919	6.0.2 P1	A user whose username contains a backslash character is unable to log in to the system.	
DMA-11915	6.0.2 P1	API: The plcm-conference-room resource has less restrictive requirements for conference room names than the web interface does.	
DMA-11882	6.1	Changing the timeout interval for IVR response entry for a VEQ has no effect; the system will use the default value (30 seconds).	
DMA-11846	6.1	The dial rule action "Resolve to virtual entry queue" handles dial strings with the format <VEQ>**<VMR> inconsistently.	
DMA-11840	5.2.2 P3	In some rare circumstances, when the RealPresence DMA system responds to a Session Description Protocol (SDP) Offer message, the SDP Answer response does not include all "m=" lines. This behavior can lead to call release.	
DMA-11493	6.0.2	On the Reports > Call History page, limiting a search to a specific territory doesn't work.	Specify a cluster or site.
DMA-11479	6.0.2	While viewing associated conferences for a conference in the Reports > Conference History list, if you repeatedly select other entries before the current query has finished, the RealPresence DMA system can report a database access error and the web interface can become unresponsive.	Allow time for each associated conference query to complete before selecting another conference.

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-11442	6.0	API: Conference updates may contain null endpoint-identifier values.	
DMA-11425	6.0.2	On the Active Calls page, the destination of a VMR call is sometimes shown as the originating endpoint.	
DMA-11390	6.1	In some cases, the userRole and failureSignalingCode columns can have incorrect information for a call in the Call Detail Records.	
DMA-11290	6.0.2	On the Site Statistics page, a new call in any site appears in all sites.	
DMA-11225	6.0.1	When a call to a VEQ is transferred to a VMR on another MCU, the call history shows the destination as the IP address for the first (VEQ) MCU.	
DMA-11135	6.0.2	The Add/Edit Direct Dial Virtual Entry Queue dialog boxes don't include the RealPresence DMA-based IVR Call Flow settings, so if an "External IVR control" entry queue is selected, the call flow can't be properly configured (prompt set, timeouts, etc.).	
DMA-11097	5.0.2	A storm of registration attempts from endpoints after an extended network outage could cause the RealPresence DMA system to become unresponsive.	
DMA-11049	6.0.1	If an RMX MCU is added to the RealPresence DMA system as a conferencing resource first, and then attempts to register with the RealPresence DMA gatekeeper, the registration fails.	Register the MCU with the RealPresence DMA gatekeeper before adding it as a conferencing resource.
DMA-10856	6.0	For AD users, the CMA system's user-to-device associations aren't available in the RealPresence DMA system.	
DMA-10812	6.0	After the RealPresence DMA cluster responsible for AD integration failed to update its cache due to a change in AD credentials, it failed to display alerts 2101 and 2107.	

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-10777	6.0	<p>In gateway calls (SIP – H.323) between the following endpoints, one side failed to get video:</p> <p>LifeSize Room 200 and Cisco (Tandberg) 6000 MXP</p> <p>LifeSize Room 200 and Polycom RealPresence Desktop</p> <p>Cisco (Tandberg) 6000 MXP and Polycom RealPresence Desktop</p>	
DMA-10771	6.0	If the RealPresence DMA system is configured to validate certificates for server connections, it can't be integrated with RealPresence Resource Manager or CMA versions prior to 7.3.	Upgrade the RealPresence Resource Manager or CMA system to 7.3.
DMA-10372	6.0	After an MCU became unavailable, SIP calls were successfully moved to another MCU, but content sharing was not.	
DMA-10300	5.1.0 P1 Hotfix 2, 6.0	In a cascaded conference, when the hub MCU became unavailable and the endpoints on it dialed back in, they correctly rejoined on a spoke MCU, but their user interfaces showed only a single endpoint in conference.	
DMA-10125	5.2	Cascade links stay up for a long time after there are no more participants on the cascaded MCU.	
DMA-10013	5.2	IPv6 VEQ calls failed to reach the VMR.	
DMA-9992	4.0.2	When a Cisco (Tandberg) EX90 endpoint using H.323 is in a call with an HDX endpoint using SIP, minor video artifacts may be seen on the Cisco endpoint.	
DMA-9991	4.0.1	When a Cisco (Tandberg) MXP 6000 endpoint using H.323 calls an HDX endpoint using SIP, the Tandberg endpoint doesn't receive video.	
DMA-9990	5.0	Although you can make changes to TCP and UDP ports separately via the API, the RealPresence DMA system web interface groups UDP and TCP ports together as a single item.	

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-9971	5.0.1	The RealPresence DMA MIB couldn't be loaded into a Zenoss 3.2.1 network manager.	<p>Download the MIB and in a text editor make the following changes in the IMPORTS section:</p> <p>Add these two lines:</p> <pre>TRAP-TYPE FROM RFC-1215</pre> <p>Change the line <pre>::= { polycom 13 }</pre> to <pre>::= { enterprises 13885 }</pre> <p>Save the changes and load the modified file into the Zenoss 3.2.1 network manager.</p> </p>
DMA-9854	5.1	When a Cisco SX20 endpoint dialed into a VMR, it connected but didn't receive video.	The Cisco SX20 endpoint is not currently supported.
DMA-9775	5.1	Call didn't connect dialing from Acme HDX h.323 to RPAD side VMR through h.323 trunk using 'id@ip' as dial string.	<p>Add following script as preliminary for 'Resolve to conference room ID' dial rule: (change <ip> to external ip of your enterprise edge server):</p> <pre>if(DIAL_STRING.match(/[0-9]{4}@<ip>)) { vmr = DIAL_STRING.replace(/([^\@]*)@.*/i, "\$1"); println(vmr); DIAL_STRING=vmr; }</pre>
DMA-9735	5.1, MFW 0.3.0	Null pointer error when updating call properties for media streams.	

Issue ID	Found in Version	Description	Workaround
DMA-9708	5.0	<p>The default Request URI format option for the postliminary of a SIP peer is equivalent to the template:</p> <p>#pscheme#:#oruser#@#phost#</p> <p>The #pscheme# placeholder is the peer's scheme. This becomes "sips" if the peer's transport type is configured as TLS, even if the original Request URI's scheme was "sip."</p> <p>Some SIP peers, such as the Cisco SBC, won't accept "sips" in the Request URI if other headers contain "sip."</p> <p>The same problem will occur if any other format option that uses #pscheme# is selected.</p>	<p>To prevent such failures, do the following:</p> <p>In the Edit External SIP Peer dialog box for the peer, go to the Postliminary tab.</p> <p>Under Request URI options, change Format to Free Form Template.</p> <p>In the Template field, replace #pscheme# with #orscheme# so that the Request URI template looks like this:</p> <p>#orscheme#:#oruser#@#phost#</p>
DMA-9700	5.1	H.323 calls to an Aethra X7 endpoint using the RealPresence DMA system as gatekeeper disconnect within one minute.	On the RealPresence DMA system's Call Server Settings page, turn off Terminate calls based upon failed responses to IRQs .
DMA-9670	5.1	SIP calls gatewayed by the RealPresence DMA system to a RealPresence Access Director configured as an external H.323 gatekeeper fail because the gatekeeper doesn't have enough information to route the call. This happens because the LRQ that the RealPresence DMA system sends to the gatekeeper contains only the E.164 digits, not the domain information, in destinationInfo.	<p>On the RealPresence DMA system's Call Server Settings page, turn on For SIP calls gatewayed to an external gatekeeper, use the H.323 email ID as the destination instead of the E.164 number.</p> <p>Note: This option affects communications with all external H.323 gatekeepers to which the RealPresence DMA system gatewayes SIP calls.</p>
DMA-9579	5.1	When calls to a VMR are rejected due to no capacity, in the conference history and CDR they aren't associated with the conference they tried to join.	To correctly associate such a call with the conference it attempted to join, match the call's destination string with the VMR number in the conference CDR.
DMA-9550	6.0, MFW 0.3.0	RealPresence DMA system doesn't restrict endpoint bandwidth for SVC calls.	
DMA-9506	5.1	If the USB Configuration Utility is used to configure a single-server system to use IPv6 only, the IPv6 network settings aren't properly implemented and the system does not start.	

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-9496	5.1	When the USB Configuration Utility was used to configure a single-server system to use IPv4+6 and split networking, the IPv6 signaling network settings weren't properly implemented.	
DMA-9463	5.1	When an external endpoint's registration request is proxied to the RealPresence DMA system by a RealPresence Access Director SBC, the RealPresence DMA system incorrectly associates the endpoint with the "Internet/VPN" site instead of the site to which the RealPresence Access Director belongs.	
DMA-9361	5.0.1	In a superclustered environment, some call events may appear out of order on the Call Events tab of the Call Details dialog box.	
DMA-9325	5.0	On the Call History page, records found by a dial string search may have an empty End Time field even though they have an end time.	
DMA-9324	5.0	When a rogue or neighbored call traverses two or more RealPresence DMA clusters within one second, the call records from the clusters aren't always merged correctly, leading to inconsistent Call History information. Note: This problem is resolved for callers managed by one of the clusters in the supercluster.	
DMA-9241	5.0	Auto-negotiation is mandatory for 1000Base-T, but the RealPresence DMA system allows it to be turned off.	Don't attempt to turn off auto-negotiation if you have a 1000Base-T network.
DMA-9139		The RealPresence DMA system doesn't support CMA or RealPresence Resource Manager address book services for H.320 devices.	
DMA-9128	5.0	The Users list can't be sorted on the Associated Endpoints column.	
DMA-9115	4.0.3 P1	The RealPresence DMA system creates an active call entry for an OCS chat INVITE.	

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-9098	4.0.3	MCUs added to a RealPresence DMA system prior to version 4.0 are deleted 30 days after upgrading to version 4.0 or later.	Working as designed. After upgrading, edit each MCU. In the Edit MCU dialog box, select Permanent to prevent the MCU's registration from expiring.
DMA-9085, 9088	5.0	On the Resource Management Server page, Model is "CMA" for a RealPresence Resource Manager system.	
DMA-9027	4.0.3	If SIP device authentication is enabled, it can be turned off for a specific endpoint, but not for a SIP peer.	
DMA-9010	5.0	Sony PCS-1 and PCS-G50 endpoints are unable to remain connected in H.323 calls when they're registered to the RealPresence DMA gatekeeper.	
DMA-8975	5.0	Attempt to edit an MCU with active calls. The system displays an error message stating that it can't be deleted when there are active calls or conferences."	
DMA-8969	5.0.1	On the Call Info tab of the Call Details dialog, the originator of the call may be misidentified.	The originator of the call is correctly identified on the Call Events tab of the Call Details dialog.
DMA-8952	5.0	When multiple API clients are creating users, a concurrent sorted search can fail.	
DMA-8940	5.0	The RealPresence DMA system should drop a Bronze call if necessary to free up bandwidth for a Gold call. But if the calls are to the same VMR, it fails to do so.	
DMA-8912	4.0.3 P1	Under certain circumstances the status between local RealPresence DMA clusters is incorrect even though the servers continue to function properly.	
DMA-8906	4.0.3 P1	The RealPresence DMA UI allowed host name and domain name entries of invalid length.	Limit host name and domain name to a combined maximum of 64 characters.
DMA-8904	5.0	On dial-outs from a VMR, the system incorrectly records the originator of the call as the endpoint called (affects Active Calls , Call History , and CDRs).	

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-8885	5.0	When a caller with a higher quality of service (QoS) setting dials into a conference and there isn't sufficient bandwidth, lower QoS calls are correctly dropped, but the higher QoS caller must redial in order to get into the conference.	
DMA-8875	5.0	When a conference uses a custom template with auto layout enabled, auto layout sometimes doesn't work.	
DMA-8489	5.0	Under certain conditions, the host portion of an endpoint's SIP URI may be altered by the internal RealPresence DMA call flow processing, and the call history record contains the altered host.	
DMA-8461	5.0	If you enable Call Forwarding No Answer on two SIP endpoints and forward each endpoint's missed calls to the other endpoint, the RealPresence DMA system does not detect the loop and will continue to dial each endpoint, even after the original caller has hung up.	
DMA-8186	4.0.3	Calls from the Lync 2010 client to a RealPresence DMA VMR hosted on an RMX 1500 MCU don't receive video.	Use an RMX 2000 or 4000 MCU.
DMA-7981	5.0	In the call CDRs of VMR calls, the userRole field for participants is often null.	
DMA-7834	4.0, 4.0.3	In rare instances, an upgrade or rollback can result in not being able to log in to the GUI as any user.	Reboot the RealPresence DMA.
DMA-7829	4.0.3	Integration to Microsoft Active Directory server sometimes fails with the message "Cache loading failed" and an alert icon with hovertext "Loading of the cache failed. Error: Timed out waiting for data from the directory." This indicates that the AD server has insufficient performance. It may occur intermittently if the RealPresence DMA is configured to use a DNS hostname or FQDN that aliases multiple AD servers, some of which have sufficient performance, and some of which do not.	Retry the integration until it succeeds. To avoid this form of cache loading failure, integrate with an Active Directory server that has sufficient performance.

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-7636	3.0 P1, 4.0, 4.0.1, 4.0.2	M100 software endpoint version 1.0 cannot successfully make calls to or receive calls from Lync users through RealPresence DMA when RealPresence DMA/Lync integration is enabled.	
DMA-7614	4.0.2	When conference management has failed over to the backup cluster for a territory, and the primary cluster is brought back online, there is a period of time (approximately 1 second for every 3000 enterprise users) when new calls can't join conferences in the territory.	
DMA-7541	4.0.2	Deleting the territory used for Active Directory integration is incorrectly permitted.	If you need to delete the default territory, create a new territory and associate it with the AD integration prior to deleting the territory associated with AD integration.
DMA-7223	4.0.2	Due to a limitation of the Microsoft Lync client on Apple computers, video is not supported on calls to or from Lync clients for the Macintosh.	Voice-only calls are supported, as long as the endpoints involved support the G.711 codec.
DMA-7168	4.0.1	HDX or Lync SIP calls to encrypted virtual meeting rooms (VMRs) via a virtual entry queue (VEQ) are hooked when being transferred to the VMR.	Use an unencrypted VMR.
DMA-7131	4.0.1	<p>A VBP allows endpoints on external networks to register through it to a LAN-side GK (RealPresence DMA), proxying H.323 events from the public network to the internal network. The VBP sends all H.323 traffic from the same call signaling address and endpoint identifier (it uses the endpoint identifier of the last endpoint that successfully registered to the gatekeeper to refresh all its endpoint registrations).</p> <p>As a result, RealPresence DMA displays all VBP calls as having the same endpoint information as the device that sent the successful registration to the RealPresence DMA and was assigned the endpoint identifier in the RCF.</p>	

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-6644	4.0	<p>As required by the H.323 specification, the RealPresence DMA system treats dial strings of the form "h323:<user>@<domain>" as url-IDs (H.323 Annex O) and dial strings of the form "<user>@<domain>" as email-IDs.</p> <p>Other gatekeepers, such as CMA and VCS, treat dial strings of the form "<user>@<domain>" as url-IDs.</p> <p>The RealPresence DMA system's different treatment of these dial strings means that calls to non-neighbored external gatekeepers are likely to fail.</p> <p>For compatibility purposes, the RealPresence DMA should have a configuration option to treat these dial strings as url-IDs.</p>	<p>To configure the RealPresence DMA system to behave like other gatekeepers, edit the Dial external networks by H.323 URL, Email ID, or SIP URI dial rule, adding the following preliminary script:</p> <pre>DIAL_STRING=DIAL_STRING.replace(/^[^:@]*@([^\@]*)/, "h323:\$1@\$2");</pre>
DMA-6524, 8447, 8500	4.0	<p>FECC (far end camera control) is not supported though the H323<->SIP gateway. The RealPresence DMA system's protocol gateway supports only audio and video.</p>	
DMA-6494	4.0	<p>When a Cisco endpoint registered to the RealPresence DMA system has TLS verification enabled, encrypted calls to the endpoint fail.</p>	<p>On the endpoint, turn off TLS verification.</p>
DMA-6480	4.0	<p>In a SIP to H.323 or H.323 to SIP call with content through the RealPresence DMA system's gateway, neither endpoint receives content-related statistics.</p>	
DMA-6459	4.0	<p>A conference passcode created on the RealPresence DMA system may not conform to the passcode rules enforced by the MCU hosting the conference, causing calls to fail.</p>	<p>Make sure that the passcodes created on the RealPresence DMA system meet the requirements of the MCUs that the system uses.</p>
DMA-6103	3.0	<p>In an environment with both a RealPresence DMA system and a Cisco Unified Conference Manager (CUCM), video path problems were encountered if certain endpoints (Cisco 9971, Polycom HDX9002, and Polycom V500) were registered to the CUCM.</p>	<p>Register the endpoints to the RealPresence DMA system.</p>

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-6101	4.0	Under some circumstances, it may become impossible to log into one server of a two-server cluster because of a heartbeat failure stemming from a time disparity between the two servers.	Use NTP to synchronize the time on both servers and reboot the servers.
DMA-6033	4.0	On the Conference Settings page, the RealPresence DMA system's default maximum bit rate setting defaults to 2048, and that limit applies to both conference and non-conference (Call Server) calls. This may cause calls to or from Immersive Telepresence (ITP) systems requiring higher bit rates to fail.	On the Conference Settings page, change the default maximum bit rate setting to Unlimited.
DMA-5862	3.0	HDX endpoints expect H.323 bandwidth to be reserved in 64 kbps increments, but the RealPresence DMA system uses smaller increments. The RealPresence DMA system may, for instance, allocate 498 kbps for a call, and the call will use that. But the endpoint displays 448 (64 * 7).	
DMA-5313	3.0	The Property Changes tab of the Call Details dialog box sometimes contains entries with duplicate sequence numbers.	
DMA-5069	3.0	In a superclustered environment, slight time drifts between clusters may produce CDR records out of order or duplicated. If NTP services are properly configured, the system self-corrects, but by then the CDR data is already committed to the database.	NTP services usually keep clocks synced to the second, but sub-second differences may exist in the CDR ordering. Be aware that event order may not be 100% accurate due to time differences. No loss of functionality or data occurs as a result of this issue.
DMA-4604	3.0	Calling a SIP endpoint registered to a Broadsoft Network Server from a SIP endpoint registered to the RealPresence DMA system may result in a calling loop.	
DMA-3750	2.3, 3.0	In a two-server cluster, under certain adverse system and/or network conditions on either server, the virtual address may move between servers when it shouldn't. This could result in the disconnection of both SIP calls and H.323 calls.	The system automatically recovers, so disconnected callers can dial back in a short time later (1 - 10 seconds).

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA-3745	2.3	It's possible to log into Server 1 of a two-server cluster and initiate an upgrade while Server 2 is still booting, causing the two servers to be out of sync and running different versions.	Do not perform upgrade, rollback, or system reconfiguration operations without both servers being up and active.
DMA-3426	2.3, 3.0	If a RealPresence DMA cluster is the primary or backup for a territory, it can't be removed from the supercluster via the management interface until the territory responsibilities are removed. But there is no warning that territory responsibilities need to be corrected afterward.	After removing a cluster from a supercluster, always check and correct territory responsibilities.
DMA-3390	2.3	If a RealPresence DMA cluster is the primary or backup for a territory, it could be removed from the supercluster via the USB Configuration Utility with no warning that territory responsibilities need to be corrected afterward.	After removing a cluster from a supercluster, always check and correct territory responsibilities.
DMA-2797	2.3	Some Sony endpoints that register with the RealPresence DMA system become unregistered after five minutes.	
DMA-2717	2.2	If a "spoke" MCU with a cascade link to the "hub" MCU is registered with an unavailable GK, callers on the two MCUs are isolated from each other. No indication in GUI or logs.	Do one of the following: Disable cascading for the conference while the GK is unavailable. Register the RMX to a working GK. Busy out the RMX while its GK is unavailable.
DMA-2411	2.2	Calls from endpoints registered to a Tandberg VCS GK don't include the IP address of the endpoint, so the RealPresence DMA system can't determine the site to which the endpoint belongs. For cascaded conferences, the call ends up either in the hub conference or, if the VCS GK is in a defined site, in a spoke conference near the VCS GK.	Place the IP address of the VCS into a site near the bridges to be used for spokes.
DMA-2362	2.3	In some situations, SIP calls from an RMX to an HDX join with only video - no audio.	
DMA-2109	2.3	Polycom V500 endpoints don't support failover of SIP registrations.	

<i>Issue ID</i>	<i>Found in Version</i>	<i>Description</i>	<i>Workaround</i>
DMA- 1939, 1941, 1948	2.3	H.323 calls using dial strings of the form <IP Address>##<Alias> sometimes fail.	<p>The RealPresence DMA supports such dial strings for both inbound and outbound calls, routing them to the specified gatekeeper or MCU IP address. Interpretation of the alias depends on the destination gatekeeper or MCU.</p> <p>Use of this feature is not recommended, however, because support for it varies significantly among different kinds of endpoints.</p>

Get Help

For more information about installing, configuring, and administering Polycom products, refer to the Documents and Downloads section at [Polycom Support](#).

The Polycom Community

[The Polycom Community](#) gives you access to the latest developer and support information. Participate in discussion forums to share ideas and solve problems with your colleagues. To register with the Polycom Community, create a Polycom online account. When logged in, you can access Polycom support personnel and participate in developer and support forums to find the latest information on hardware, software, and partner solutions topics.

Polycom Solution Support

Polycom Implementation and Maintenance services provide support for Polycom solution components only. Additional services for supported third-party Unified Communications (UC) environments integrated with Polycom solutions are available from Polycom Global Services and its certified Partners. These additional services will help customers successfully design, deploy, optimize, and manage Polycom visual communications within their UC environments.

Professional Services for Microsoft Integration is mandatory for Polycom Conferencing for Microsoft Outlook and Microsoft Office Communications Server or Lync 2010 Server integrations. For additional information, please see http://www.polycom.com/services/professional_services/index.html or contact your local Polycom representative.