

# Patch Notes

## Polycom RealPresence Capture Server

---

<b>Patch ID:</b>	v1.7 Rev.16506
<b>Released file:</b>	<i>CaptureServer-1.7.0.0-16506-2014-11-26-01-51.pkg</i>
<b>Affected version:</b>	Versions older than v1.7 Rev.16506
<b>Release date:</b>	12/19/2014

### Purpose

Systems running Capture Server versions older than v1.7 Rev.16506 must first be patched with this patch to ensure the normal operation of Fallback feature after system upgrade to version 1.8.

### Prerequisites and Configuration Considerations

Install this patch only on RealPresence Capture Server systems with patch v1.7 Rev.16506 installed.

### Functionality Affected

This patch only fixes functionality, it does not change functionality.

### Installation Notes

To update a RealPresence Capture Server system, complete the following tasks:

1. Download the patch file.
2. Save a backup of the Polycom RealPresence Capture Server database.
3. Perform the software upgrade.
4. Verify the upgrade.

For more information on performing each of these tasks, see the *Polycom RealPresence Capture Server User Guide*.

This patch performs the following:

- Stops the RealPresence Capture Server services
- Reinstall RealPresence Capture Server package
- Reboots the RealPresence Capture Server system

### Rollback Considerations

There is no procedure to uninstall this hot fix. You must re-image the system to return it to v1.7.

## Resolved Issues

This patch fixes the following issues.

Issue #	Description
DSTC-1760	Sometimes Capture Server streaming suddenly stopped working.
DSTC-1778	After system upgrade from 1.6 to 1.7, scheduled live Capture Server calls error was observed from RealPresence Media Manager.
PCTCRSS-6692	Web server used plain text authentication forms port 80.
PCTCRSS-6693	HttpOnly flag was not set on cookies.
PCTCRSS-6697	In rare situations, when you played the live streaming, the media player showed black screen.
PCTCRSS-6698	After system upgrade from 1.6 to 1.7, quick code playback of archives generated from 1.6.x failed.
PCTCRSS-6699	Snapshots could not display in Media Manager v6.6 from Capture Server v1.7 in the CSN.
PCTCRSS-6705	If you go to <b>Configuration &gt; Signaling Settings</b> , configure H.323 and SIP settings and click <b>OK</b> , the same confirmation message <i>recording server will be started</i> popped up twice.
PCTCRSS-6714	For the last offline transcoding template, if <b>Media Type</b> was set as <b>WMV</b> and Layout as <b>Dual window for content</b> , after you select <b>Snapshot Enable</b> on <b>Snapshot</b> tab, snapshots cannot be displayed and downloaded.
PCTCRSS-6720	If you upgrade the Capture Server system from 1.6 to 1.7 then to 1.8 and perform fallback, the system restored to version 1.6 instead of 1.7.
PCTCRSS-6732	Sometimes VRRs and Recording Templates disappeared from Admin Portal and you could not dial out to record.
PCTCRSS-6758	Sometimes you created a VRR and used the VRR, but the VRR disappeared.
PCTCRSS-6789	When you upgrade from versions prior to 1.8 via Admin Portal, after it redirected you to the login page, it booted into recovery mode and side miss HDD.
PCTCRSS-6915	After system reboot, only 50 templates and 50 VRRs could be displayed on portal and the remainders were missing.
PCTCRSS-6916	In some situations, when you upgrade from versions prior to 1.8 via http, after the upgrade was complete, it did not successfully redirect you to the https login page of the Admin Portal when the upgrade was completed.
PCTCRSS-7011	Sometimes the signaling status was wrong on Capture Server system.